



VOLUME 19, 2025

PUBLISHED ARTICLES

15 ▾ ENTRIES PER PAGE



RESEARCH ARTICLE

Open Access

DOI: 10.2174/0118741495375592250610133455

Ability of Technologies to Collect the Positioning and Occupancy of Work Crews and Resources on Construction Job Sites

Volume: 19 (2025): e18741495375592 [Electronic Publication Date: June 13, 2025]

Stéphane Morin Pépin and Adel Francis

Abstract

View Fulltext HTML

PDF

Download ePub



RESEARCH ARTICLE

Open Access

DOI: 10.2174/0118741495391593250513114323

Experimental Investigation of the Elastic Moduli of Existing Minangkabau Wooden Buildings using Non-Destructive Testing

Volume: 19 (2025): e18741495391593 [Electronic Publication Date: May 22, 2025]


Yosafat Aji Pranata, Olga Catherina Pattipawaej, Amos Setiadi and Irma Novrianty Nasution

Abstract

View Fulltext HTML

PDF

Download ePub

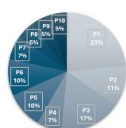

RESEARCH ARTICLE

Open Access

DOI: 10.2174/0118741495398469250428061055

Machine Learning Techniques Evaluating Housing Projects Performance

Volume: 19 (2025): e18741495398469 [Electronic Publication Date: April 30, 2025]


Ali Hassoon, Farid Ezanee Mohamed Ghazali, Tareq A. Khaleel, Ahmed Hadi and Mundher M. Alsamarraie

Abstract

View Fulltext HTML

PDF

Download ePub

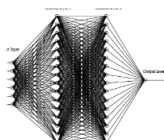

RESEARCH ARTICLE

Open Access

DOI: 10.2174/0118741495387193250411105201

Artificial Neural Network Models for Predicting Required Cross-section Dimensions of Concrete Filled Steel Tubular Columns

Volume: 19 (2025): e18741495387193 [Electronic Publication Date: April 21, 2025]

Samir Al-Zgul, Vasilina Tyurina, Anton Chepurmenko and Vladimir Akopyan

Abstract

View Fulltext HTML

PDF

Download ePub



RESEARCH ARTICLE

Open Access

DOI: 10.2174/011874149537955250410082448

Structural Response of Post-tensioned Slabs Reinforced with Forta-Ferro Under Impact Load: Experimental and Numerical Approach

Volume: 19 (2025): e18741495379555 [Electronic Publication Date: April 14, 2025]

Sandy Chaaban, Yehya Tamsah and Mohamad Darwiche

Abstract

View Fulltext HTML

PDF

Download ePub

SCOPUS CITESCORE

1.9

PUBLISHED CONTENTS

Select Volume ▾

DOWNLOAD FLYER

VIEW VOLUME

SEARCH ARTICLES

SEARCH TERM

Search Articles...

SEARCH CRITERIA:

Article Title / Keywords / Abstract ▾

ARTICLE TYPE:

All Article Types ▾

CLEAR

SEARCH

TRACK YOUR MANUSCRIPT

ENTER CORRECT MANUSCRIPT

REFERENCE NUMBER:

Track...

SUBMIT REFERENCE NUMBER

JOIN OUR TEAM

Join as an Editorial Board Member

Join as a Reviewer

Join as a Guest Topical Issue Editor

MARKETING OPPORTUNITIES

Advertising Policy

Kudos

Promotional Services

PRESS RELEASE

NEWS RELEASE DATE



RESEARCH ARTICLE

Open Access

DOI: 10.2174/0118741495376804250307042847





Strength of Concrete Slabs Reinforced with Carbon Fiber Reinforced Polymer under Torsion

Volume: 19 (2025): e18741495376804 [Electronic Publication Date: March 20, 2025]

Ghassan M. Werdina



Abstract

View Fulltext HTML

PDF

Download ePub



RESEARCH ARTICLE

Open Access

DOI: 10.2174/0118741495381331250213070615

Mechanical and Thermal Properties of Self-Curing Metakaolin-based Geopolymer Mortar in Hot-arid Climate

Volume: 19 (2025): e18741495381331 [Electronic Publication Date: March 18, 2025]


Keltoun Bekraoui, Hamid Khelafi, Mohamed Mouli, Mhammed Abdeldjalil and Aida Bensekhria

Abstract

View Fulltext HTML

PDF

Download ePub

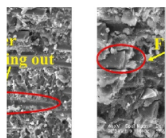

RESEARCH ARTICLE

Open Access

DOI: 10.2174/0118741495286261240321032411

Impact of Wood Ash on the Properties of Micro Basalt Fiber Cement Mortar

Volume: 19 (2025): e18741495286261 [Electronic Publication Date: February 27, 2025]

Abbas Abdulhussein Abd Noor, Paschal Chimeremeze Chiadighikaobi, Paul Aondokato Angahar and Makhmud Kharun

Abstract

View Fulltext HTML

PDF

Download ePub



RESEARCH ARTICLE

Open Access

DOI: 10.2174/0118741495360335241205110710

The Impact of Schedule Compression Techniques on Construction Project Timelines: A Case Study in Basrah, Iraq

Volume: 19 (2025): e18741495360335 [Electronic Publication Date: February 13, 2025]


Khaldoon Shehab Al-Tameemi

Abstract

View Fulltext HTML

PDF

Download ePub

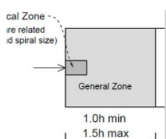

RESEARCH ARTICLE

Open Access

DOI: 10.2174/0118741495370548250203060848

Finite Element Analysis of Fiber Reinforced Concrete Eccentric Anchorage Zone in Prestressed Girders

Volume: 19 (2025): e18741495370548 [Electronic Publication Date: February 10, 2025]


Ghassan M. Werdina

Abstract

View Fulltext HTML

PDF

Download ePub

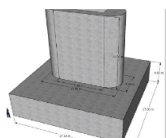

RESEARCH ARTICLE

Open Access

DOI: 10.2174/0118741495375637250131112435

Temperature Development and Heat Control Analysis In Palu Bridge Pile Cap And Pillar

Volume: 19 (2025): e18741495375637 [Electronic Publication Date: February 04, 2025]

Mudji Irmawan, Christino Boyke, Kohar Yudoprasteyo and M. Fadhlhan Rosyidi

Abstract

View Fulltext HTML

PDF

Download ePub



RESEARCH ARTICLE

Open Access

DOI: 10.2174/0118741495372949250114055629

Excess Pore Water Pressure Ratio Comparison from Empirical and Numerical Methods to Determine Liquefaction Potential in Palu, Central Sulawesi, Indonesia

Volume: 19 (2025): e18741495372949 [Electronic Publication Date: January 17, 2025]

Mukhlis Habib Al Rahman, Teuku Faisal Fathani and Wahyu Wilopo

Abstract

View Fulltext HTML

PDF

Download ePub

26 JANUARY 2024

Bentham Is Proud To Announce Collaboration With Elsevier

NEWS RELEASE DATE

25 JULY 2023

Three Journals Receive Impact Factors

NEWS RELEASE DATE

17 FEBRUARY 2023

The Nursing Journal Directory Indexes Bentham Journal, The Open Public Health Journal

ADVERTISEMENT



THE INTERNATIONAL
MEDICINE AND BIOSCIENCES
CONFERENCE 2026

22nd in the series of Eureka Science conferences

Publish in Impact Factor &
Scopus-Indexed Journals!
Exclusive Opportunity for TIMBC
Conference Participants

Call for Papers and Presentations

Hosted by Eureka Science

Submit Abstract Now!



ABOUT US

- About the Journal
- About the Publisher
- Editorial Board
- FAQs
- Open Access Policy
- Open Url Guidelines

FOR AUTHORS

- Archiving Policies
- Article Processing Charges
- Author Benefits
- Bentham Author Support Services
- Authorship
- Bentham Manuscript Processing System
- Institutional Membership
- Instructions for Authors
- Manuscript Transfer Facility
- Special Fee Waivers and Discounts

FOR EDITORS & REVIEWERS

- Editorial Management
- Editorial Policies
- Ensuring Content Integrity
- Ethical Guidelines for New Editors
- Guest Editor Guidelines
- Virtual Special Issue
- Peer Review Workflow
- Publication Process
- Guidelines for Peer Reviewers

ETHICAL GUIDELINES

- Allegations from Whistleblowers
- Conflict of Interest
- Fabricating and Stating False Information
- Plagiarism Prevention
- Post Publication Discussions and Corrections
- Publishing Ethics
- Research Misconduct

JOIN OUR TEAM

- Join as an Editorial Board Member
- Join as a Reviewer
- Join as a Guest Topical Issue Editor

MARKETING OPPORTUNITIES

- Advertising Policy
- Kudos
- Promotional Services



Experimental Investigation of the Elastic Moduli of Existing Minangkabau Wooden Buildings using Non-Destructive Testing



Yosafat Aji Pranata^{1,*} , Olga Catherina Pattipawaej² , Amos Setiadi³  and Irma Novrianty Nasution⁴ 

¹Master Program in Civil Engineering, Faculty of Smart Technology and Engineering, Universitas Kristen Maranatha, Bandung, Indonesia

²Bachelor Program in Civil Engineering, Faculty of Smart Technology and Engineering, Universitas Kristen Maranatha, Bandung, Indonesia

³Doctoral Program in Architecture, Faculty of Engineering, Universitas Atma Jaya Yogyakarta, Sleman, Yogyakarta, Indonesia

⁴The Buildings Engineering Education Department, Faculty of Engineering, Universitas Negeri Medan, Deli Serdang, Medan, Indonesia

Abstract:

Introduction: The existing Minangkabau traditional wooden buildings that are more than 100 years old are commonly found in Tanah Datar Regency, West Sumatra Province, Indonesia. However, it is necessary to assess the residual strength of the wood to evaluate the main structural members, such as beams and main columns, which may have experienced a decrease in strength. The aim of this research is to carry out non-destructive testing to obtain the dynamic elastic moduli of the existing buildings.

Methods: Non-destructive testing was conducted using ultrasound technology specifically designed for wood. The members studied were the main columns and beams of the existing buildings. This study focused on the two existing Minangkabau wooden buildings located in Tanah Datar Regency.

Results: The test results for the first building yielded a dynamic elastic modulus (MoE_d) of 14,600.8 MPa, with a standard deviation of 1,803.1 MPa and a coefficient of variation of 12.35% (0.1235). In comparison, the second building showed a dynamic elastic modulus of 11,108.52 MPa, with a standard deviation of 1,720.14 MPa and a coefficient of variation of 15.48% (0.1548). Additionally, the elastic modulus for the first building was 10,282.25 MPa, while the second building had an elastic modulus of 7,822.90 MPa.

Discussion: The results from this study indicated that the elastic modulus of the first existing building showed a trend of no significant decrease in strength. These results matched with visual observation that the tested columns and beams did not experience damage. In contrast, the test results for the second building indicated that the tested main beams experienced a decrease in strength due to damage, which ranged from 28.23% to 35.18%.

Conclusion: The non-destructive testing of existing timber buildings offers benefits, including providing recommendations for repairs and assessing structural members that need to be replaced due to strength degradation using the same quality or the same species of timber. This study suggests a non-destructive testing method for evaluating existing timber buildings.

Keywords: Beam, Column, Elastic moduli, Minangkabau, Wood, Dynamic elastic modulus.

© 2025 The Author(s). Published by Bentham Open.

This is an open access article distributed under the terms of the Creative Commons Attribution 4.0 International Public License (CC-BY 4.0), a copy of which is available at: <https://creativecommons.org/licenses/by/4.0/legalcode>. This license permits unrestricted use, distribution, and reproduction in any medium, provided the original author and source are credited.

* Address correspondence to this author at the Master Program in Civil Engineering, Faculty of Smart Technology and Engineering, Universitas Kristen Maranatha, Bandung, Indonesia; E-mail: yosafat.ap@gmail.com

Cite as: Pranata Y, Pattipawaej O, Setiadi A, Nasution I. Experimental Investigation of the Elastic Moduli of Existing Minangkabau Wooden Buildings using Non-Destructive Testing. Open Civ Eng J, 2025; 19: e18741495391593. <http://dx.doi.org/10.2174/0118741495391593250513114323>



Received: February 25, 2025

Revised: March 14, 2025

Accepted: March 26, 2025

Published: May 22, 2025



Send Orders for Reprints to
reprints@benthamscience.net

1. INTRODUCTION

Wooden buildings that are built without special protection will generally experience a decrease in strength due to damage or weather influences. Traditional Minangkabau houses, which are numerous in West Sumatra Province, for example, in Tanah Datar Regency, include buildings built without special protection. After construction, the wood is typically painted but lacks additional protective treatment. Wood is susceptible to weather effects, so it is crucial to protect it from moisture. One of the protection methods is applying a layer of protective varnish to the exterior parts and structural members to create a barrier against the members. To preserve the natural appearance of the wood, it may be necessary to apply periodic treatments, such as transparent varnishes. These treatments protect the structural members from stains and fading.

The existing Indonesian traditional wooden buildings named Minangkabau that are more than 100 years old are commonly found in Tanah Datar Regency, West Sumatra Province, Indonesia. These buildings continue to function as residences. From a structural perspective, there is no significant damage even though there have been several earthquakes hitting the area. However, it is still necessary to check the remaining strength of the wood to evaluate main structural members, such as beams and columns, that may have experienced a decrease in strength due to the influence of weather, age, or other pest attacks. One of the assessment methods for investigating the residual strength of wood in existing buildings is the non-destructive method [1, 2] because this method does not cause damage to the existing structural members of buildings. This method was previously widely used to study the remaining strength of living trees to avoid the possibility of trees falling due to heavy rain or earthquakes [3, 4]. Non-destructive testing in the engineering field is not only used in building structures made from wood, but also in other materials [5-7].

This research aimed to carry out non-destructive testing to obtain the dynamic elastic moduli of the existing buildings.

This research focused on traditional Indonesian wooden buildings, namely Minangkabau, located in Tanah Datar Regency, West Sumatra Province, Indonesia. Two

existing buildings were studied, both classified as historic structures. The first building, Rumah Gadang Datuak Bandaro Kuniang (coordinates: -0.4617653266, 100.5713323962), is shown in Fig. (1). The second building, Rumah Tuo Kampai nan Panjang Balimbiang (coordinates: -0.5224518903, 100.5699440901), is shown in Fig. (2). Non-destructive testing was conducted using ultrasound technology for wood quality assessment by employing the Sylvestest 4 [8] test equipment. The buildings members studied were the main columns and beams. To obtain consistent velocity data, the column and beam elements selected for testing had a dry moisture content ranging from 10% to 18% [2]. The temperature conditions in the area where the buildings are located are above 0°C, so the velocity test data do not require correction with an adjustment factor [2].

2. LITERATURE STUDY

2.1. Previous Research

Since the elastic modulus is an important parameter for designing compression members, tension members, flexural members, and connections in timber buildings, accurate prediction of its value is essential for building calculations and design. Research and development of testing equipment using non-destructive methods was initiated by Sandoz [9], who developed an instrument for grading construction timber using the ultrasound method.

The past research on wood testing using acousto-ultrasonics was carried out by Sandoz *et al.* [10]. This research highlighted several acousto-ultrasonic parameters for the non-destructive evaluation of timber strength. Technological developments and calibrations are expected to facilitate its industrial application in timber transformation, like defect detection and grading of timber. Acousto-ultrasonics has been used for the inspection and accurate grading of wooden pole networks in asset management [11]. Another previous study used non-destructive technology to evaluate the mechanical properties of timber in existing wooden historical monuments [12]. Research on the use of instruments with ultrasound wave-based methods is also complemented by the development of empirical equations to determine the ratio of dynamic elastic moduli to elastic moduli, as seen in the studies by Fabiana *et al.* [13] and Francesco *et al.* [14].



Fig. (1). The first existing building, namely Rumah Gadang Datuak Bandaro Kuniang.



Fig. (2). The second existing building, namely Rumah Tuo Kampai Nan Panjang, Balimbiang.

Ultrasound-based prediction of bending properties for several softwood species grown in Turkey was also conducted [15], with the results providing predictions of dynamic elastic moduli for these timber species. Additionally, research on the use of non-destructive techniques for the determination of the mechanical properties of wood from urban trees in Spain was also carried out [16].

2.2. The Ultrasonic Measurement and an Acousto-Ultrasonic Measuring Device

The ultrasonic method was first introduced in t 1985. This method, used for measuring the mechanical properties of timber (specifically elastic moduli), was validated for wood as a structural material. In 1989, technology transfer was achieved with the development of

a non-destructive testing device named Sylvatest [8]. This device measures the speed of wave propagation in the main longitudinal direction of the wood.

The speed of propagation is correlated to the elastic moduli, while the energy is correlated to the knots, grain direction, degradation area, etc. Sylvatest is an acousto-ultrasonic measuring device that provides a diagnosis of the timber log, structural member of a building (for example, column and beam), or bridge element (for example, timber truss bridge), based on the speed of the transmitted ultrasonic wave.

There are two methods of registering the wave propagated by the material in non-destructive testing in terms of ultrasonic waves, which are indirect and direct methods. In the direct method, the time of transmitting a signal between the receiver and the transducer is measured. The instruments are placed on the opposite plane to the sample tested. In the indirect method, both the instrument heads are placed on the wooden surface (on the same plane) of the sample and register the reflected signal [17].

Some potential limitations of ultrasonic non-destructive testing methods, for example, potential measurement errors due to internal defects that cannot be detected by ultrasound, can be overcome by selecting a defect-free surface so that the wave propagation speed data transmitted by the transducer can be recorded accurately by the receiver. The influence of moisture content on the accuracy of test results is a major concern in this study. Therefore, the wood tested was wood with a dry moisture content in the range of 10% to 18% so that the velocity data results remained accurate [2].

2.3. The Dynamic Elastic Moduli

With the two parameters, which are the timber log's direct velocities (V) and the timber density (ρ), the dynamic elastic moduli can be calculated [17] using Equation 1, and the dynamic elastic moduli have a ratio to the static elastic moduli of 1.42 when the velocity is measured with ultrasound [14]. The static elastic moduli can be calculated using Equation 2:

$$\text{MoE}_d = \rho \times V^2 \times 10^{-6} \quad (1)$$

$$\text{MoE} = \frac{\text{MoE}_d}{1.42} \quad (2)$$

Where: MoE_d is the dynamic elastic moduli of the timber, ρ is the specific gravity or the timber density (kg/m^3) at 12% of moisture content, V is the timber log's direct velocities (m/s), and MoE is the elastic moduli of the timber.

2.4. Physical and Mechanical Properties of Johar Wood (*Cassia Siamea* Lamk)

Johar wood is a subfamily of *Caesalpiniaceae* that thrives in India, Indonesia, Malaysia, Philippines, Vietnam, Laos, and Thailand. In Indonesia, Johar wood is widely distributed in the areas of Java, West Nusa Tenggara, North Sumatra, and West Sumatra. Based on the literature, the specific gravity (average) of Johar wood is 0.805 (805 kg/m^3) [18]. Meanwhile, previous research conducted by Nanjar [19] provided parameters for the physical properties of Johar wood (*Senna siamea*), including a specific gravity (G) of 0.69, equivalent to 690 kg/m^3 .

The elastic modulus of Johar wood is 116500 kg/cm^2 or 11875.64 MPa , according to the International Tropical Timber Organization [20]. The previous research by Mulyani and Prawiroharmojo [21] indicated that the elastic modulus of Johar wood is 118400 kg/cm^2 (12069.32 MPa). However, according to the Wood Database [22], the elastic modulus of Johar wood is 10900 MPa , and the average specific gravity is 0.71 (710 kg/m^3). Meanwhile, according to Manthani and Fauzan [23], the elastic modulus of Johar wood is 11000 MPa , and the specific gravity is 800 kg/m^3 . A summary of previous research on the physical and mechanical properties of Johar wood is presented in Table 1.

2.5. Repair Method for Timber Building

In previous research, Jose outlined the principles for the restoration of existing wooden buildings [24]. The study demonstrated that it is possible to preserve difficult and demanding architectural construction while adhering to modern construction methodologies. This approach involves restoring structures using non-mechanical beam-to-column connections, as well as column and beam members made from wood of the same quality or species as the original.

Table 1. Previous studies on the physical and mechanical properties of johar wood.

References	Specific Gravity	Elastic Modulus (MPa)
Suharnantono [18]	0.805	-
Nanjar [19]	0.69	-
ITTO [20]	-	11875.64
Mulyani and Prawiroharmojo [21]	-	12069.32
Wood database [22]	0.7	10900
Manthani and Fauzan [23]	0.8	11000

Splice repairs [25] involve the simple substitution of defective elements in a timber structure with new members of the same species or quality, which are fitted to the old structures that have lost strength due to damage. When repairs are required for timber elements in an existing building, the repair process must be guided by the results of thorough diagnostic investigations, ensuring that the wooden elements in need of replacement are accurately identified.

3. METHODS

This study used a non-destructive testing method, with the test object being the column and beam components of the existing building. The purpose of the test was to obtain empirical data and facts on the wave propagation velocity, which were then converted into dynamic elastic moduli parameters. After the dynamic elastic moduli (MoE_d) parameters were obtained, the next stage was to compare the dynamic elastic moduli of existing wood with the

secondary data reference of the elastic moduli (MoE) of Johar wood (*Cassia siamea Lam*).

The results of the study provide information on whether the elastic moduli of the existing buildings remain within the range of undamaged wood or if they have experienced a decrease in strength. This information is very important to provide recommendations on whether to replace wooden components in existing buildings if there has been a decrease in strength or damage. The flowchart of the research is shown in Fig. (3).

Specimens for the non-destructive tests were the existing main columns and beams of the buildings, the first building, namely Rumah Gadang Datuak Bandaro Kuniang, and the second building, namely Rumah Tuo Kampai nan Panjang Balimbiang, where the sample points for placing the transducer and receiver were visually sorted to obtain defect-free parts. The location of non-destruction testing in Tanah Datar Regency, West Sumatra Province, Indonesia, is presented in Fig. (4).

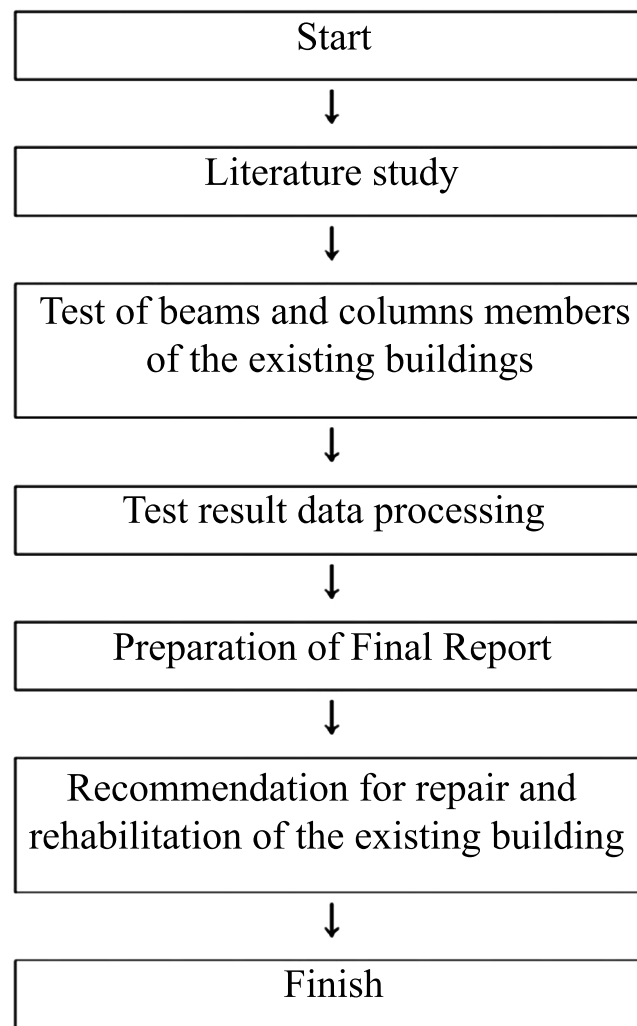


Fig. (3). Flowchart and method of research.

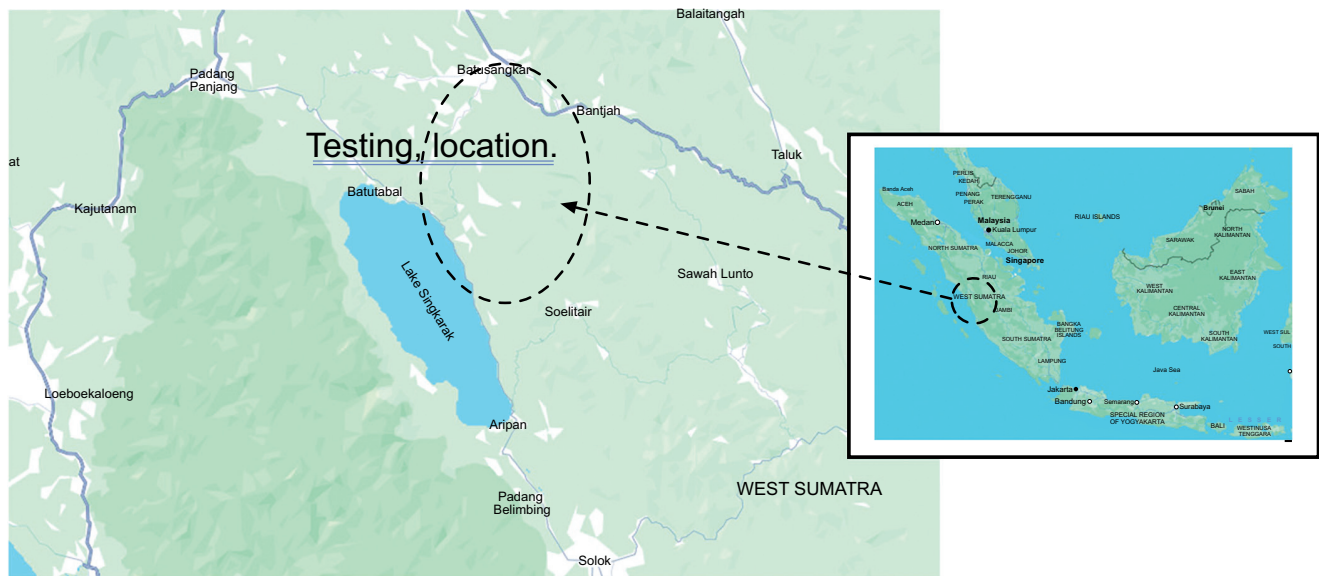


Fig. (4). Location of non-destruction testing in tanah datar regency, West Sumatra province, Indonesia.

4. RESULTS AND DISCUSSION

Two wooden buildings were studied. The first building had a floor plan, as shown in Fig. (5). Fig. (6) shows the

testing process for the first building. The floor plan of the second building is shown in Figs. (7, and 8) depicts the testing process for the second building.


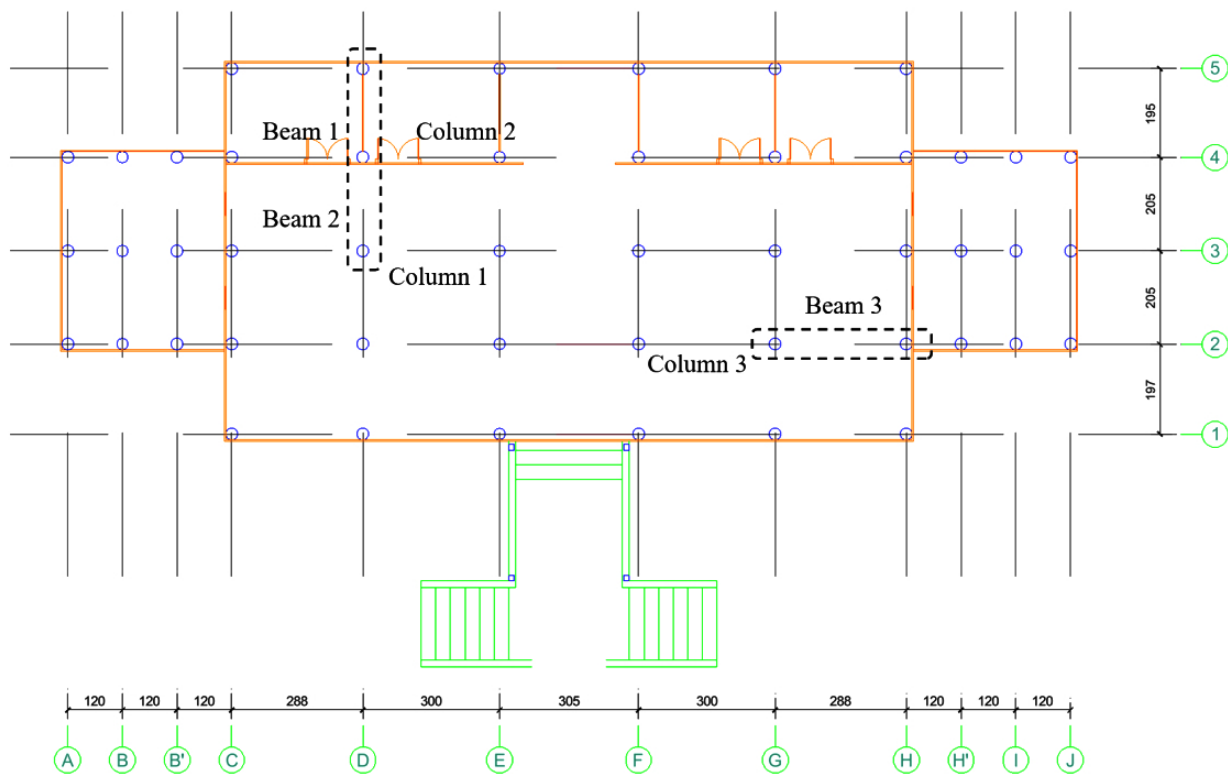



Fig. (5). The floor plan of the first building. The main columns and main beams were tested.



(a). The main columns of the first building

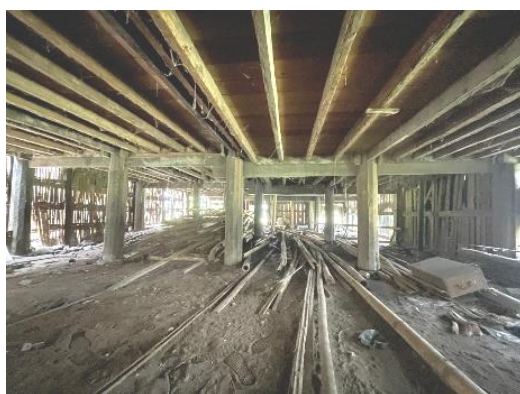

(b). Ground level of the first building

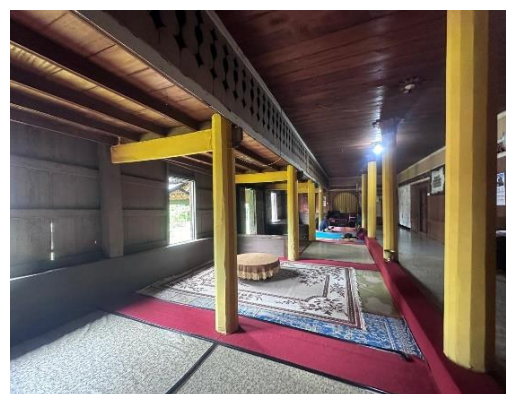

(c). +2,2 Meter level of the first building

Fig. (6a-c). The first existing building, rumah gadang datuak bandaro kuniang.

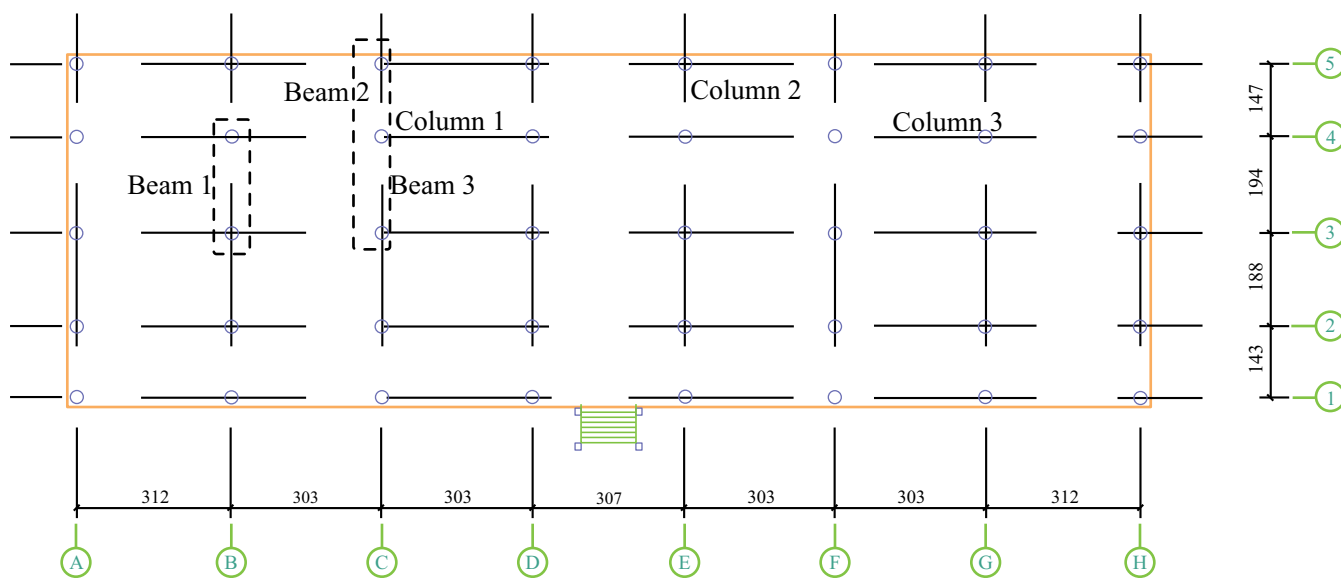


Fig. (7). The floor plan of the second building. The main columns and main beams were tested.



(a). The main column and beam of the second building



(b). Ground level of the second building (c). +2,2 Meter level of the second building

Fig. (8a-c). The second existing building, rumah tuo kampai nan panjang balimbiang .

For both the first and the second buildings, the column members reviewed were 3 main columns, while for beam members, three main column members and three main beam members were reviewed. Each structural member was subjected to non-destructive testing at 9 test points. In total, there were 54 test points (each house). The main floor beams (both the first and the second buildings) were at a height of +2.2 meters above ground level. None of the main beams or column members were given a protective layer to facilitate easy testing. The indirect method was used for the test.

Both the transducer and receiver were not blocked by the surface layer of wood. The complete test results for the two buildings are shown in Fig. (9) (first existing building) and Fig. (10) (second existing building), representing the direct velocities (V) of the timber logs.

The test results generally indicated that the velocity (V) obtained ranged from 4000 m/s to 5226 m/s with a mean value of 4558.54 m/s, a standard deviation of 281.95 m/s, and a coefficient of variation of 6.19% for the first building, while for the second building, a velocity ranging from 3497 m/s to 4747 m/s was obtained with a mean of 3972.26 m/s, a standard deviation of 303.6 m/s, and a coefficient of variation of 7.64%. These results were then further processed into dynamic elastic modulus parameters using Equation 1. The complete calculation results are shown in Fig. (11) for the first building and Fig. (12) for the second building.

The first building and the second building are both made from Johar (*Cassia siamea* Lam.) timber, with the wood quality class being in the class I-II range based on the Indonesian Wood Atlas [26]. The test results generally indicated that the dynamic elastic modulus obtained was in the range from 11200 MPa to 19117.75 MPa with a mean of 14600.8 MPa, a standard deviation of 1803.1 MPa, and a coefficient of variation of 12.35% (0.1235) for the first building, while for the second building, a dynamic elastic modulus ranging from 8560.31 MPa to 15773.81 MPa was obtained with a mean of 11108.52, a standard deviation of 1720.14 MPa, and a coefficient of variation of 15.48% (0.1548). This coefficient of variation value was lower than the allowable limit of 25% (0.25) in accordance with the NDS timber code [27] and the SNI timber code [28], indicating accurate test results.

These dynamic elastic moduli (MoE_d) values were then converted into elastic moduli (MoE) using Equation 2 [7]. The dynamic elastic modulus has a ratio of 1.42 to the static elastic modulus when the velocity is measured using ultrasound. The complete calculation results are presented in Table 2, indicating that the elastic modulus of the first existing building (Rumah Gadang Datuak Bandaro Kuniang) has a trend similar to the one observed in several studies [15-18]. These results matched with visual observation that the tested columns and beams did not experience damage.

However, the test results for the second building (Rumah Tuo Kampai nan Panjang) demonstrated a lower elastic modulus, indicating that the beams and columns selected for testing had experienced a decrease in strength with a relative difference of 28.23% to 35.18%

lower than the reference [17, 16]. Based on visual observations during testing of the second building, there was indeed a decrease in strength because the main beams began to be damaged due to the influence of the weather.

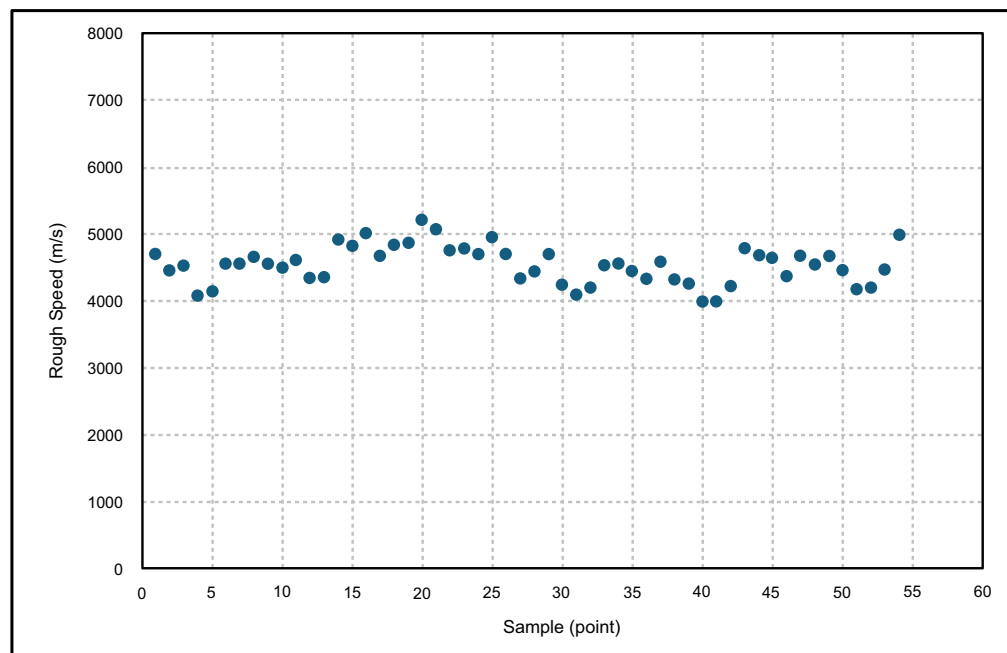


Fig. (9). Results of the velocities (rough speeds) obtained from non-destructive testing of the first existing building.

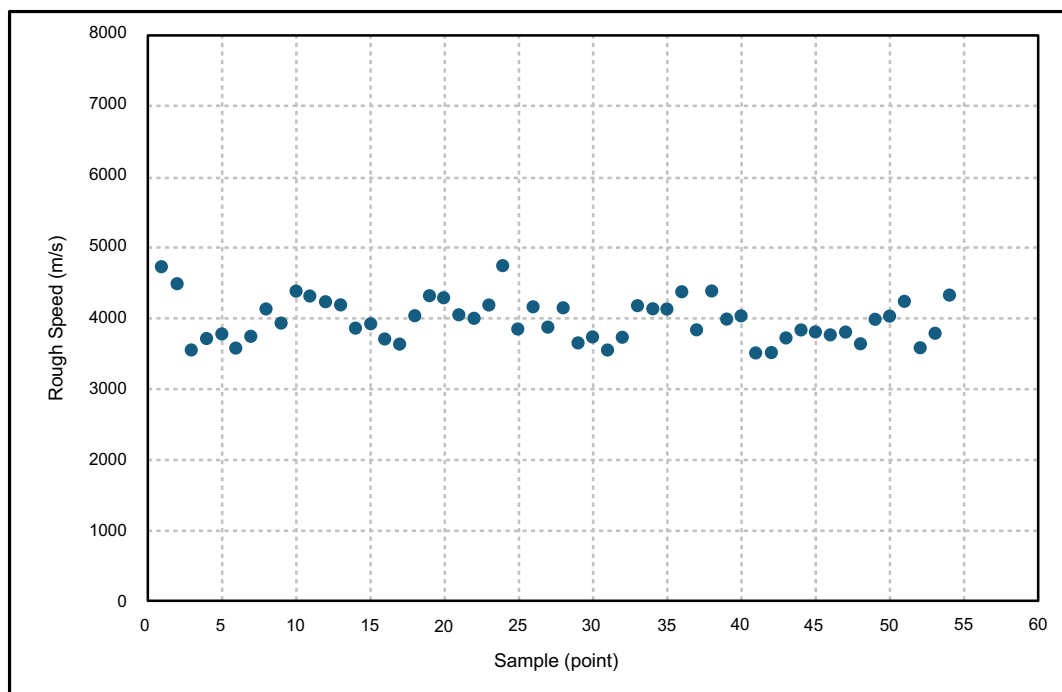


Fig. (10). Results of the velocities (rough speeds) obtained from non-destructive testing of the second existing building.

Table 2. Results obtained from research: The dynamic elastic moduli and the elastic moduli.

Existing Building	The Dynamic Elastic Moduli (MPa)	The Elastic Moduli (MPa)
Rumah Gadang Datuak Bandaro Kuniang	14600.80	10282.25
Rumah Tuo Kampai nan Panjang	11108.52	7822.90

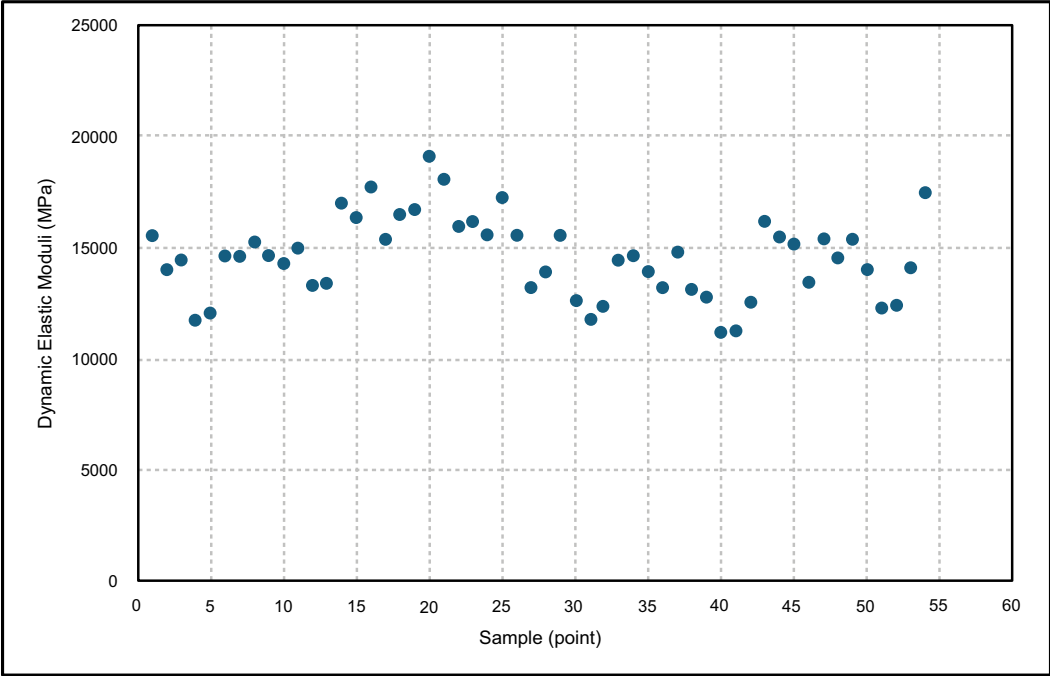


Fig. (11). Results of the dynamic elastic modulus of the first existing building.

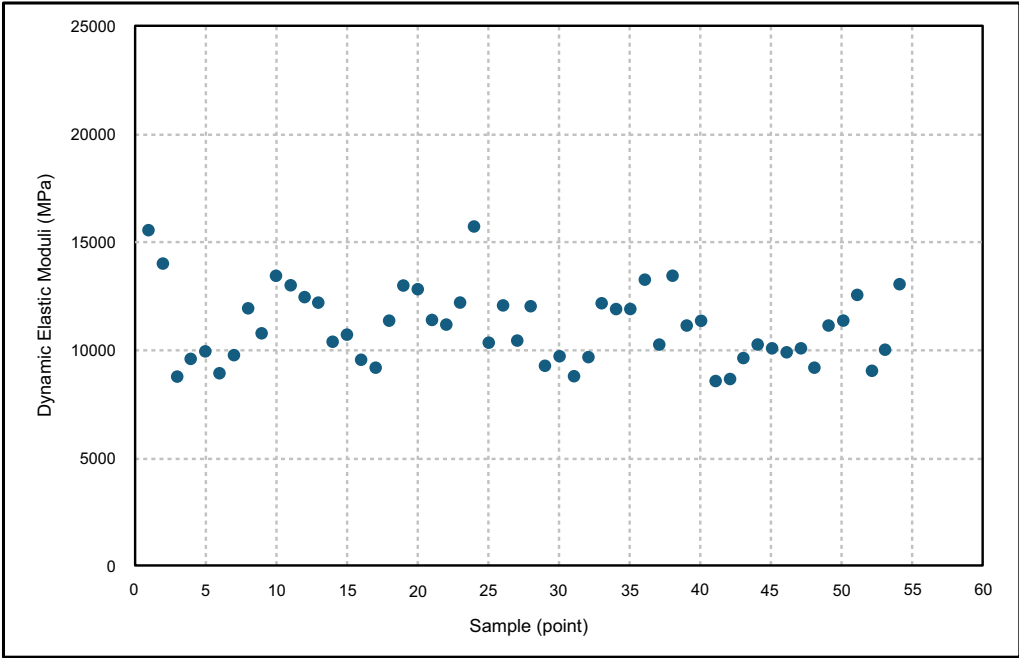


Fig. (12). Results of the dynamic elastic modulus for the second existing building.

CONCLUSION

In this study, the first existing building (Rumah Gadang Datuak Bandaro Kuniang) had a dynamic elastic modulus of 14600.8 MPa with a standard deviation of 1803.1 MPa and a coefficient of variation of 12.35% (0.1235), while the second existing building (Rumah Tuo Kampai nan Panjang) had a dynamic elastic modulus of 11108.52 MPa with a standard deviation of 1720.14 MPa and a coefficient of variation of 15.48% (0.1548). This coefficient of variation value was found to be lower than the allowable limit of 25% (0.25), indicating accurate test results.

The first building had an elastic modulus of 10282.25 Mpa, while the second building had an elastic modulus of 7822.90 MPa. The results indicated that the elastic modulus of the first existing building demonstrated a trend similar to the reference, and there was no decrease in strength. These results matched with visual observation that the tested columns and beams did not experience damage. In contrast, the test results for the second building indicated that the tested main beams experienced a decrease in strength (ranging from 28.23% to 35.18%) due to damage.

This study employs a non-destructive testing method for evaluating existing buildings. This method was previously widely used to assess the remaining strength of living trees to prevent the risk of trees falling due to heavy rain or earthquakes. It offers several benefits, including recommendations for assessing building components that need to be replaced due to a decrease in strength using new wood of equivalent quality.

AUTHORS' CONTRIBUTIONS

The authors confirm their contribution to the paper as follows: data collection: IN; data analysis or interpretation: OP; methodology: AS; draft manuscript: YP. All authors reviewed the results and approved the final version of the manuscript.

LIST OF ABBREVIATIONS

V	=	Timber log's direct velocities
G	=	Specific gravity
ρ	=	Timber density

CONSENT FOR PUBLICATION

Not applicable.

AVAILABILITY OF DATA AND MATERIALS

The data supporting the findings of the article is available in the [Zenodo Repository] at [https://zenodo.org/records/15493414/files/0418097801_NDTM.pdf?download=1], reference number [version v1].

FUNDING

This study was funded by Ministry of Education, Culture, Research, and Technology Funder ID: Regular Fundamental Research National Competitive Research (Awards/Grant number: 106/E5/PG.02.00.PL/2024).

CONFLICT OF INTEREST

The authors confirm that this article's content has no conflict of interest.

ACKNOWLEDGEMENTS

Declared none.

REFERENCES

- [1] H. Hasnikova, and P. Kuklik, "Various non-destructive methods for investigation of timber members from a historical structure", *Wood Res.*, vol. 59, no. 3, pp. 411-420, 2014.
- [2] D.F. Llana, G.I. Gonzalez, and F. Arriaga, "Influence of temperature and moisture content on non-destructive measurements in scots pine wood", *Wood Res.*, vol. 59, no. 5, pp. 769-780, 2014.
- [3] A. Ettelaei, M. Layeghi, H. Zarea Hosseinabadi, and G. Ebrahimi, "Prediction of modulus of elasticity of poplar wood using ultrasonic technique by applying empirical correction factors", *Measurement*, vol. 135, pp. 392-399, 2019.
[http://dx.doi.org/10.1016/j.measurement.2018.11.076]
- [4] D.F. Llana, G. Íñiguez-González, M.R. Díez, and F. Arriaga, "Nondestructive testing used on timber in Spain: A literature review", *Maderas Cienc. Tecnol.*, vol. 22, no. ahead, p. 0, 2020.
[http://dx.doi.org/10.4067/S0718-221X2020005000201]
- [5] D. Jin, K. Xin, L. Yin, S. Mohammadi, B. Cetin, and Z. You, "Performance of rubber modified asphalt mixture with tire-derived aggregate subgrade", *Constr. Build. Mater.*, vol. 449, p. 138261, 2024.
[http://dx.doi.org/10.1016/j.conbuildmat.2024.138261]
- [6] J. Hongmei, Y. Hongwen, F. Zhiyong, S. Longhui, Z. Shiyu, and Z. Yingliang, "Early performance modification of a waste-derived super-sulfated cement from arsenic-containing bio-oxidation waste via calcium aluminate and calcium sulfoaluminate cement", *Constr. Build. Mater.*, vol. 441, p. 137529, 2024.
[http://dx.doi.org/10.1016/j.conbuildmat.2024.137529]
- [7] D. Jin, S. Mohammadi, K. Xin, L. Yin, Z. You, and Z. You, "Laboratory performance and field demonstration of asphalt overlay with recycled rubber and tire fabric fiber", *Constr. Build. Mater.*, vol. 438, p. 136941, 2024.
[http://dx.doi.org/10.1016/j.conbuildmat.2024.136941]
- [8] "Sylvatest 4, nondestructive technology using ultrasounds for wood quality assessment", Available from: Available from: <https://cbs-cbt.com/en/technology/sylvatest-5-112-5>.
- [9] J.L. Sandoz, "Grading of construction timber by ultrasound", *Wood Sci. Technol.*, vol. 23, no. 1, pp. 95-108, 1989.
[http://dx.doi.org/10.1007/BF00350611]
- [10] J.L. Sandoz, Y. Benoit, and L. Demay, "Wood testing using acousto-ultrasonic technique", *Proceedings of the 12th International Symposium on Nondestructive Testing of Wood University of Western*, , 2000
- [11] J.L. Sandoz, and Y. Benoit, "New technologies for wooden poles network asset management", *18th International Conference and Exhibition on Electricity Distribution (CIRED 2005)* 2005.
[http://dx.doi.org/10.1049/cp:20050880]
- [12] J.L. Sandoz, and Y. Benoit, "Nondestructive technology for wooden historical monuments", The Institute of Non-Destructive Testing: British, 2007, pp. 1-9.
- [13] F.G.R. Oliveira, J.A.O. Campos, and A. Sales, "Ultrasonic measurements in brazilian hardwood", *Mater. Res.*, vol. 5, no. 1, pp. 51-55, 2002.
[http://dx.doi.org/10.1590/S1516-14392002000100009]
- [14] F. Arriaga, C. Osuna-Sequera, I. Bobadilla, and M. Esteban, "Prediction of the mechanical properties of timber members in existing structures using the dynamic modulus of elasticity and visual grading parameters", *Constr. Build. Mater.*, vol. 322, p. 126512, 2022.
[http://dx.doi.org/10.1016/j.conbuildmat.2022.126512]
- [15] E. Guntekin, T.Y. Aydin, and P. Niemi, "Prediction of young's

- modulus in three orthotropic directions for some important turkish wood species using ultrasound", *Conference: 19th International Nondestructive Testing and Evaluation of Wood Symposium* 2015.
- [16] X.A. Rosas-Ramos, M.A.M. Borja-De La Rosa, R. MacHucavelasco, A. Corona-Ambriz, L. Cuapio-Hernández, and L. Acuña-Rello, "Evaluation of wood quality of pinus montezumae lamb. in a disturbed forest using non-destructive acoustic methods", *Wood Res.*, vol. 69, no. 2, pp. 297-310, 2024.
[<http://dx.doi.org/10.37763/wr.1336-4561/69.2.297310>]
- [17] M. Wyjadlowski, T.P. Nowak, and A. Karolak, "Investigation of wooden sheet pile wall in an aggressive environment using non-destructive methods", *MATEC Web Conf.*, vol. 251, no. 288, p. 02038, 2018.
[<http://dx.doi.org/10.1051/mateconf/201825102038>]
- [18] H. Suharnantono, *Monitoring and Evaluation of Exotic Jungle Plant Types in KPH Kendal*, KPH Kendal, Perhutani: Indonesia, 2011, pp. 1-6.
- [19] Y.U. Nanjar, *Analysis of the Influence of Johar Wood Connection Forms from East Sumba on Multi-Storey Buildings*, Bachelor Program in Civil Engineering: Tribhuwana Tunggaladewi Malang, 2022.
- [20] "International tropical timber organization", Available from: <http://www.tropicaltimber.info/specie/johar-cassia-javanica>
- [21] S.R.D.M. Mulyani, and S. Prawiroharmojo, "Variation of anatomical structure, chemical and physical-mechanical properties of johar wood (*Cassia sianiea* Lamk)", Thesis, Master in Forestry Science, University of Gadjah Mada, 2000.
- [22] E. Meier, "The wood database", Available from: <https://www.wood-database.com/pheasantwood>
- [23] K. Manthani, and M. Fauzan, "Design and analysis of west sumatera indigenous building structure against the durability on earthquake", *J. Civil Environ. Eng.*, vol. 4, no. 1, pp. 25-36, 2019.
- [24] A.F. Jose, "Methodology of rehabilitation of timber structures in historic buildings", *Conference: World Conference on Timber Engineering 2023 (WCTE2023)* 2023
[<http://dx.doi.org/10.52202/069179-0520>]
- [25] "Property care association", Available from: <https://www.property-care.org/professionals/guidance/structural-repairs/timber>
- [26] *Indonesian Wood ATLAS.*, Forest Department: Indonesia, 2005, pp. 1-8.
- [27] *The 2024 national design specification for wood construction.*, American Wood Council Wood Design Standards Committee: United States, 2024.
- [28] *SNI 7973 design specifications for wood construction.*, National Standardization Agency: USA, 2013.